Installation Instructions for SEL-CR 1-Phase, Remote Target

Before installation of fault indicators and sensors, read and understand all instructions in their entirety. For assistance, contact Customer Service at (509) 332-1890 or by email at info@selinc.com.

Install fault indicators and sensors in accordance with normal safe operating practices. These instructions are not intended to replace or supersede existing safety or operating requirements. Only trained qualified personnel should install or operate fault indicators and sensors.











Neutral Training for Phase Sensor

The way the neutral is trained and the correct placement of all FCI sensors are essential for proper function of the FCI. Shown are several methods of neutral training. Note the position of each FCI sensor. Double-back training is the preferred method.

Three acceptable methods are shown. The last method prevents proper FCI function. *Do not use* this method when applying FCI sensors.

Install the Display

- Punch or drill two 10.5 mm (25/64 in) holes (Dia. B) and one 27 mm (1 1/16 in) hole (Dia. A), as shown in the diagram, or use the template to align the holes (consult with the enclosure manufacturer for the recommended corrosion treatment of the holes).
- Remove the polycarbonate plate from the assembly kit bag and secure it to the mounting structure with carriage bolts, flat washers, and nuts, as shown in the diagram.
- ► Slide the stainless-steel mounting plate onto the carriage bolts.
- > Position the target area of the display against the polycarbonate plate.
- > Secure the polycarbonate plate with the lock washers and nuts.







SEL

Installation Instructions for SEL-CR 1-Phase, Remote Target

Install the Phase Sensor(s)







core around the cable.



Verify that the core is closed and properly mated.

Magnetic Cable Guides hold cables and leads neatly within the enclosure.

Catalog Number: MCG





